View NSN Online: https://aerobasegroup.tw/nsn/6850-01-292-5188 GACO WESTERN INC -- N-450-9 -- 6850-01-292-5188 Product ID:N-450-9 MSDS Date:12/01/1997 FSC:6850 NIIN:01-292-5188 MSDS Number: CGFPX === Responsible Party === Company Name: GACO WESTERN INC Address:18700 S CENTER PKY Box:88698 City:SEATTLE State:WA ZIP:98188-4636 Country:US Info Phone Num:206-575-0450 Emergency Phone Num:206-575-0450 800-424-9300(CHEMTREC) CAGE:09 463 === Contractor Identification === Company Name: GACO WESTERN INC

Address:18700 S CENTER PKY

Box:88698 City:SEATTLE State:WA

ZIP:98188-4636 Country:US

Phone: 206-575-0450

Contract Num:SP0450-99-M-ND62

CAGE:09463

======= Composition/Information on Ingredients ========

Ingred Name: TOLUENE (SARA 313) (CERCLA)

CAS:108-88-3

RTECS #:XS5250000 Fraction by Wt: 62%

Other REC Limits: NONE RECOMMENDED

OSHA PEL:200 PPM; Z-2 ACGIH TLV:S, 50 PPM; 9596

EPA Rpt Qty:1000 LBS DOT Rpt Qty:1000 LBS

Ingred Name: METHYL ETHYL KETONE (2-BUTANONE) (MEK) (SARA 313) (CERCLA) CAS:78-93-3 RTECS #:EL6475000 Fraction by Wt: 32% Other REC Limits: NONE RECOMMENDED OSHA PEL:200 PPM ACGIH TLV:200 PPM/300STEL;9596 EPA Rpt Qty:5000 LBS DOT Rpt Qty:5000 LBS =========== Hazards Identification ================= LD50 LC50 Mixture:ORAL LD50 (RAT) IS 636 MG/KG TOLUENE Routes of Entry: Inhalation:YES Skin:YES Ingestion:NO Reports of Carcinogenicity:NTP:NO IARC:NO OSHA:NO **Health Hazards Acute** and Chronic: EYES: MAY CAUSE SEVERE IRRITATION.SKIN:MAY CAUSE IRRITATION AND DEFATTING.INGEST:MAY CAUSE GI TRACT IRRITATION.INHAL: MAY CAUSE RESPIRATORY IRRITATION AND CNS DEPRESSION.CHRONIC:MAY CAUSE ALLERGIC SENS ITIZATION(OCCUPATIONAL ASTHMA) AND HEARTDISEASE. Explanation of Carcinogenicity: TOLUENE MAY BE HARMFUL TO THE FETUS BASED ON LABORATORY STUDIES. Effects of Overexposure:EYES:REDNESS,TEARING,BLURRED VISION. Medical Cond Aggravated by Exposure: PREEXISTING EYE, SKIN, C **ENTRAL** NERVOUS SYSTEM AND RESPIRATORY DISORDERS MAY BE AGGRAVATED BY EXPOSURE TO THIS PRODUCT. First Aid:SKIN:REMOVE CONTAMINATED CLOTHING:WASH WITH SOAP AND WATER.EYES:FLUSH WITH WATER FOR 15 MINUTES.CONTACT PHYSICIAN. INHAL:REMOVE TO FRESH AIR.GIVE OXYGEN OR ARTIFICIAL RESPIRATION IF NEEDED. INGEST:DO NOT INDUCE VOMITING.GET PROMPT QUALIFIEDMEDICAL ATTENTION.


======= Fire Fighting Me asures ===========

Flash Point Method:TCC Flash Point:20.0F,-6.7C

Lower Limits: 1.0

Extinguishing Media: WATER FOG, CARBON DIOXIDE, DRY CHEMICAL, FOAM. Fire Fighting Procedures: WEAR FIRE FIGHTING PROTECTIVE EQUIPMENT AND A FULL FACED SELF CONTAINED BREATHING APPARATUS. COOL FIRE EXPOSED CONTAINERS WITH WATER FOG.

Unusual Fire/Explosion Hazard: VAPORS HEAVIER THAN AIR. CAN TRAVEL ALONG GROUND AND FLAHSBACK, COMBUSTION OR HEAT OF FIRE MAY PRODUCE HAZARDOUS DECOMPOSITION PR

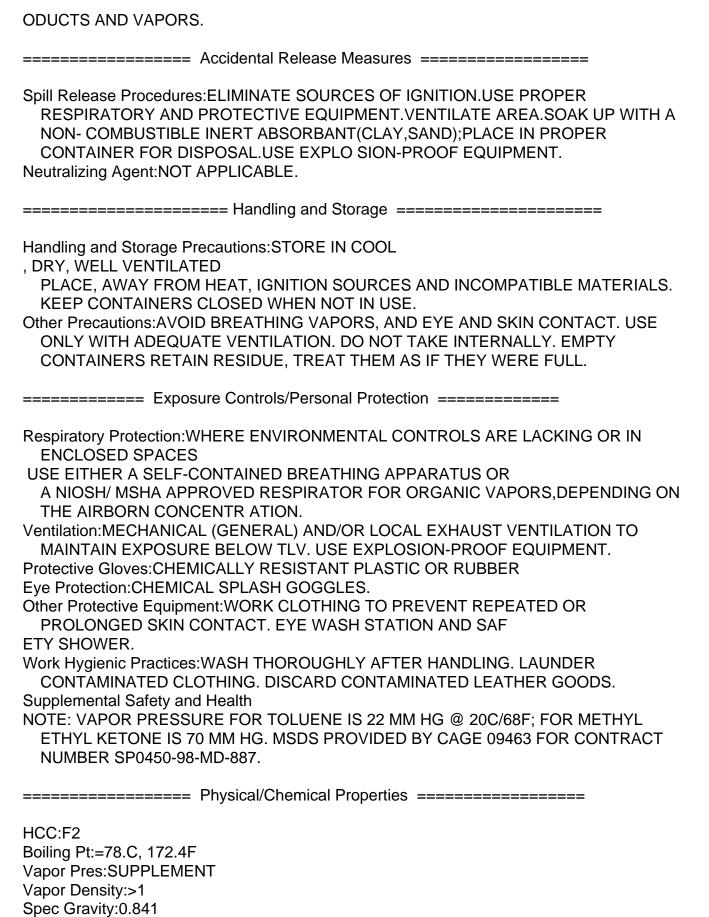

Εv

